




# Palm Treo 680 Microphone Replacement

Written By: Maiya123

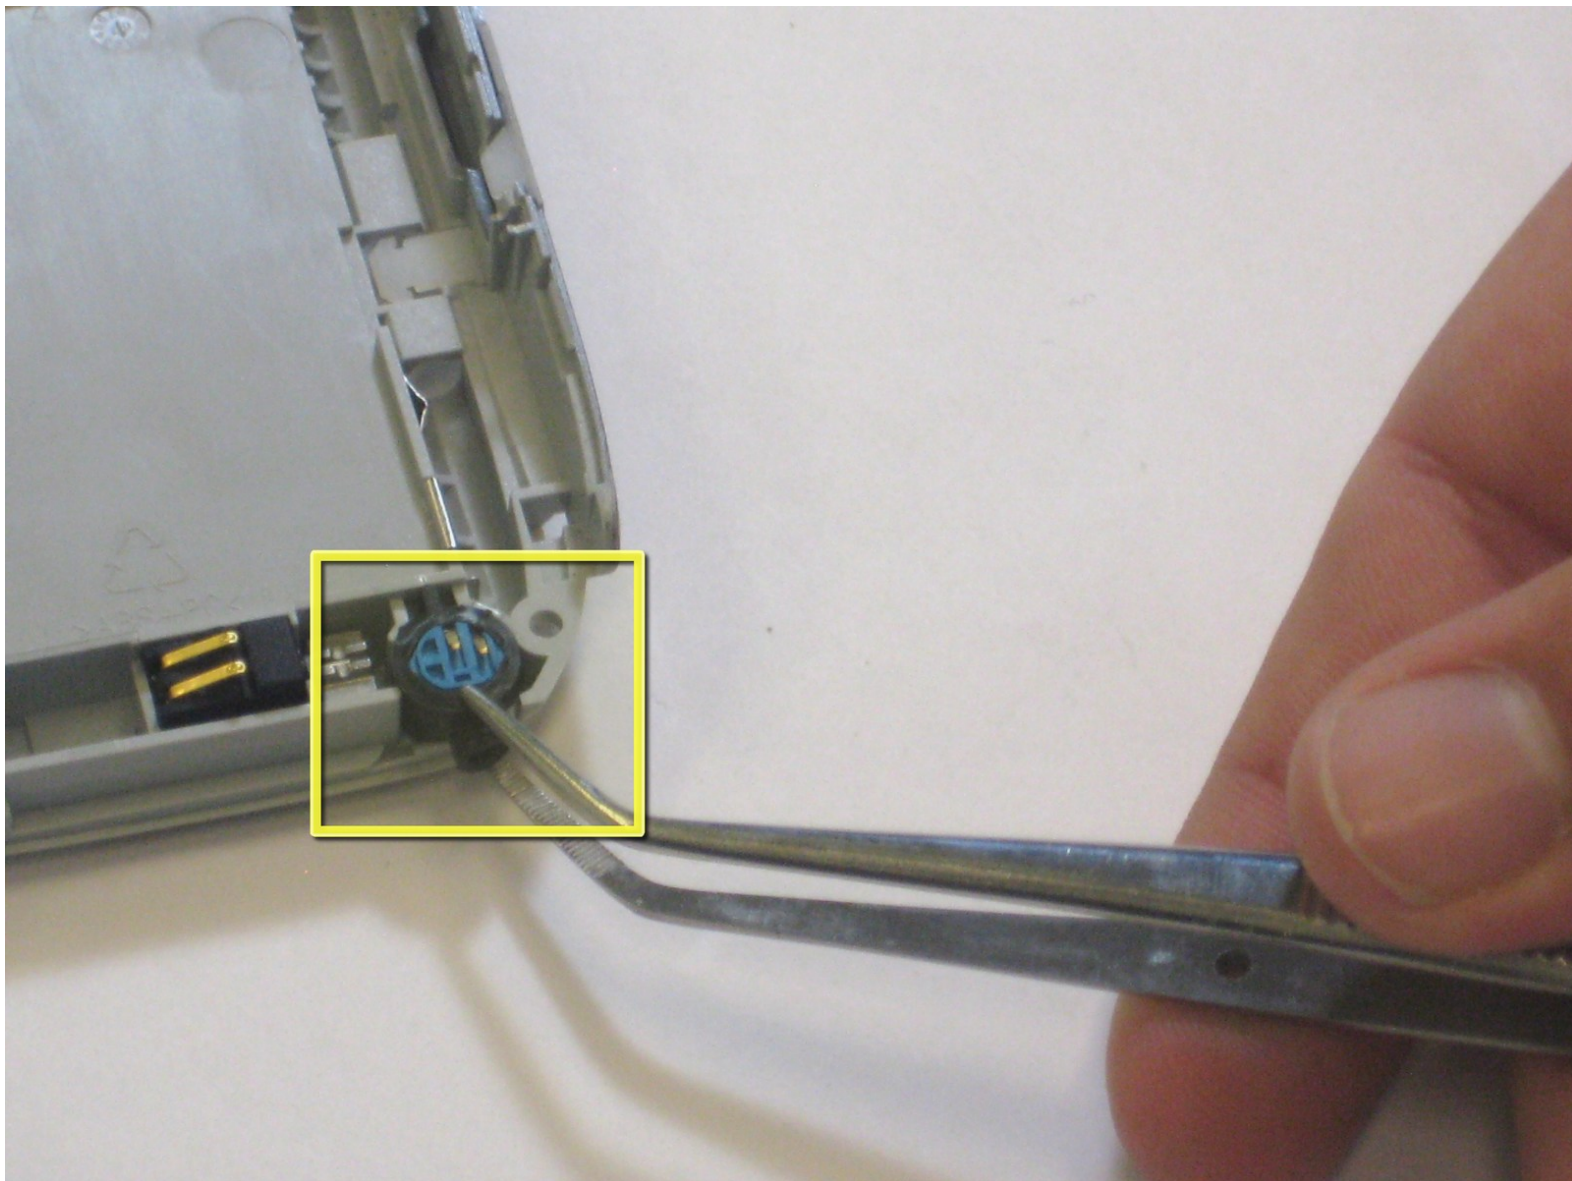

## INTRODUCTION

This is a guide that indicates how to replace a faulty microphone for the Palm Treo 680.

---



### TOOLS:

- [Metal Spudger](#) (1)
  - [Phillips #00 Screwdriver](#) (1)
  - [Tweezers](#) (1)
-

## Step 1 — Battery



- Press down on the small rectangular button on the back of the phone with your index finger.
- Slide the battery cover off the device.


## Step 2



- Remove the battery by grasping it and pulling it toward you.




## Step 3 — Back Panel

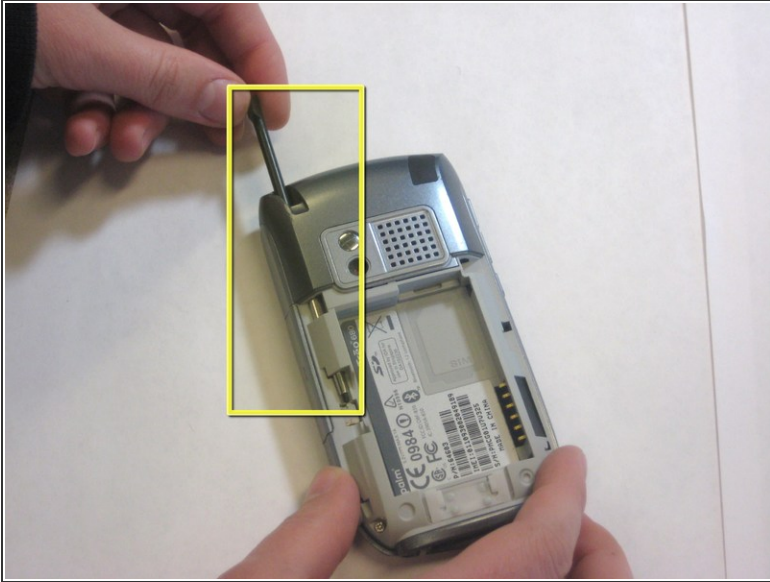

- Unscrew the 0.266 inch top-left screw with a T6 Torx Screwdriver.

✦ Be sure to remove the stylus in order to access the screw.

## Step 4

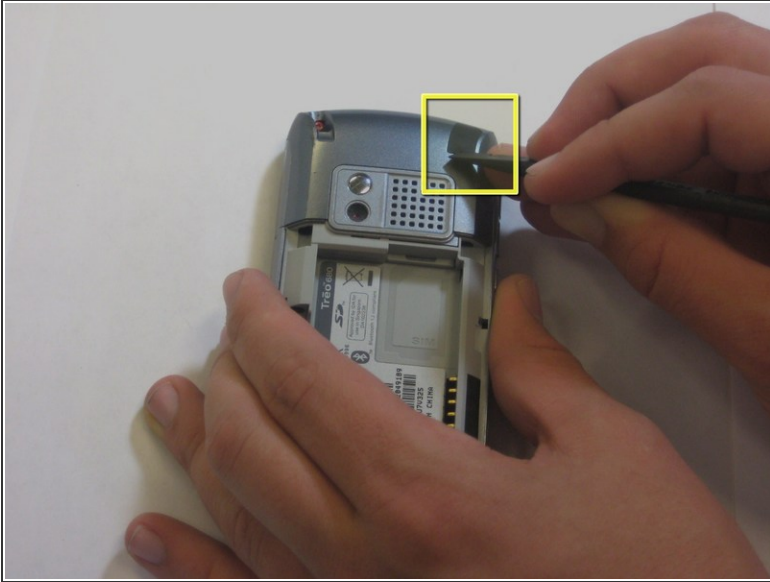

- Using the spudger, remove the rubber rectangular cover located in the upper right hand side of the device.
- Unscrew the 0.266 inch screw with the T6 Torx Screwdriver.
  - ⓘ If there is a red Palm sticker covering the screw, just puncture it to access the screw.

## Step 5




- Remove the remaining two 0.266 inch screws at the bottom of the device.

## Step 6



- Turn the phone 90 degrees to the right, so the screen is facing the right side.
  - Use a spudger to carefully separate the back panel from the front panel to access all the various components inside the phone.
- ⚠ Separate the covers from the left side of the device as indicated in the picture. The right side contains orange ribbons that are easily damaged.

## Step 7 — Microphone

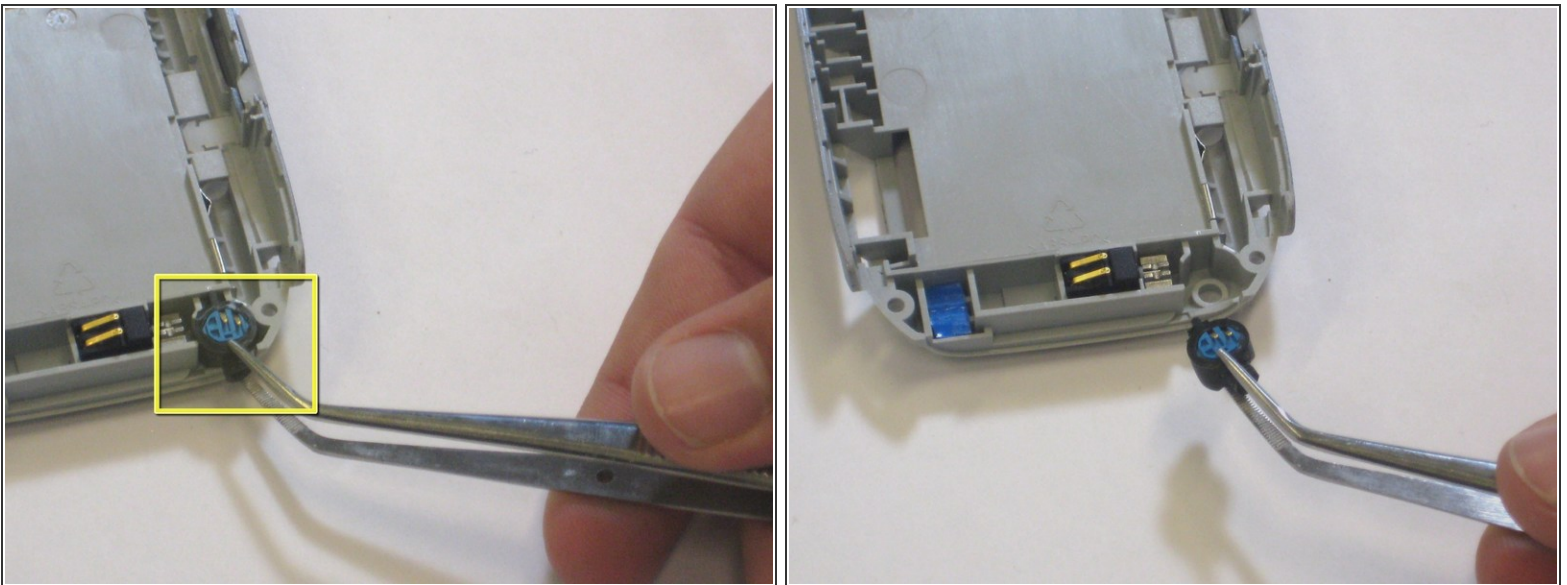

- Using a pair of tweezers, grasp the blue rubber microphone.
- Pull the rubber microphone up and back to remove it.
- Now you have successfully removed the microphone.

To reassemble your device, follow these instructions in reverse order.

This document was last generated on 2017-07-25 01:42:26 PM.